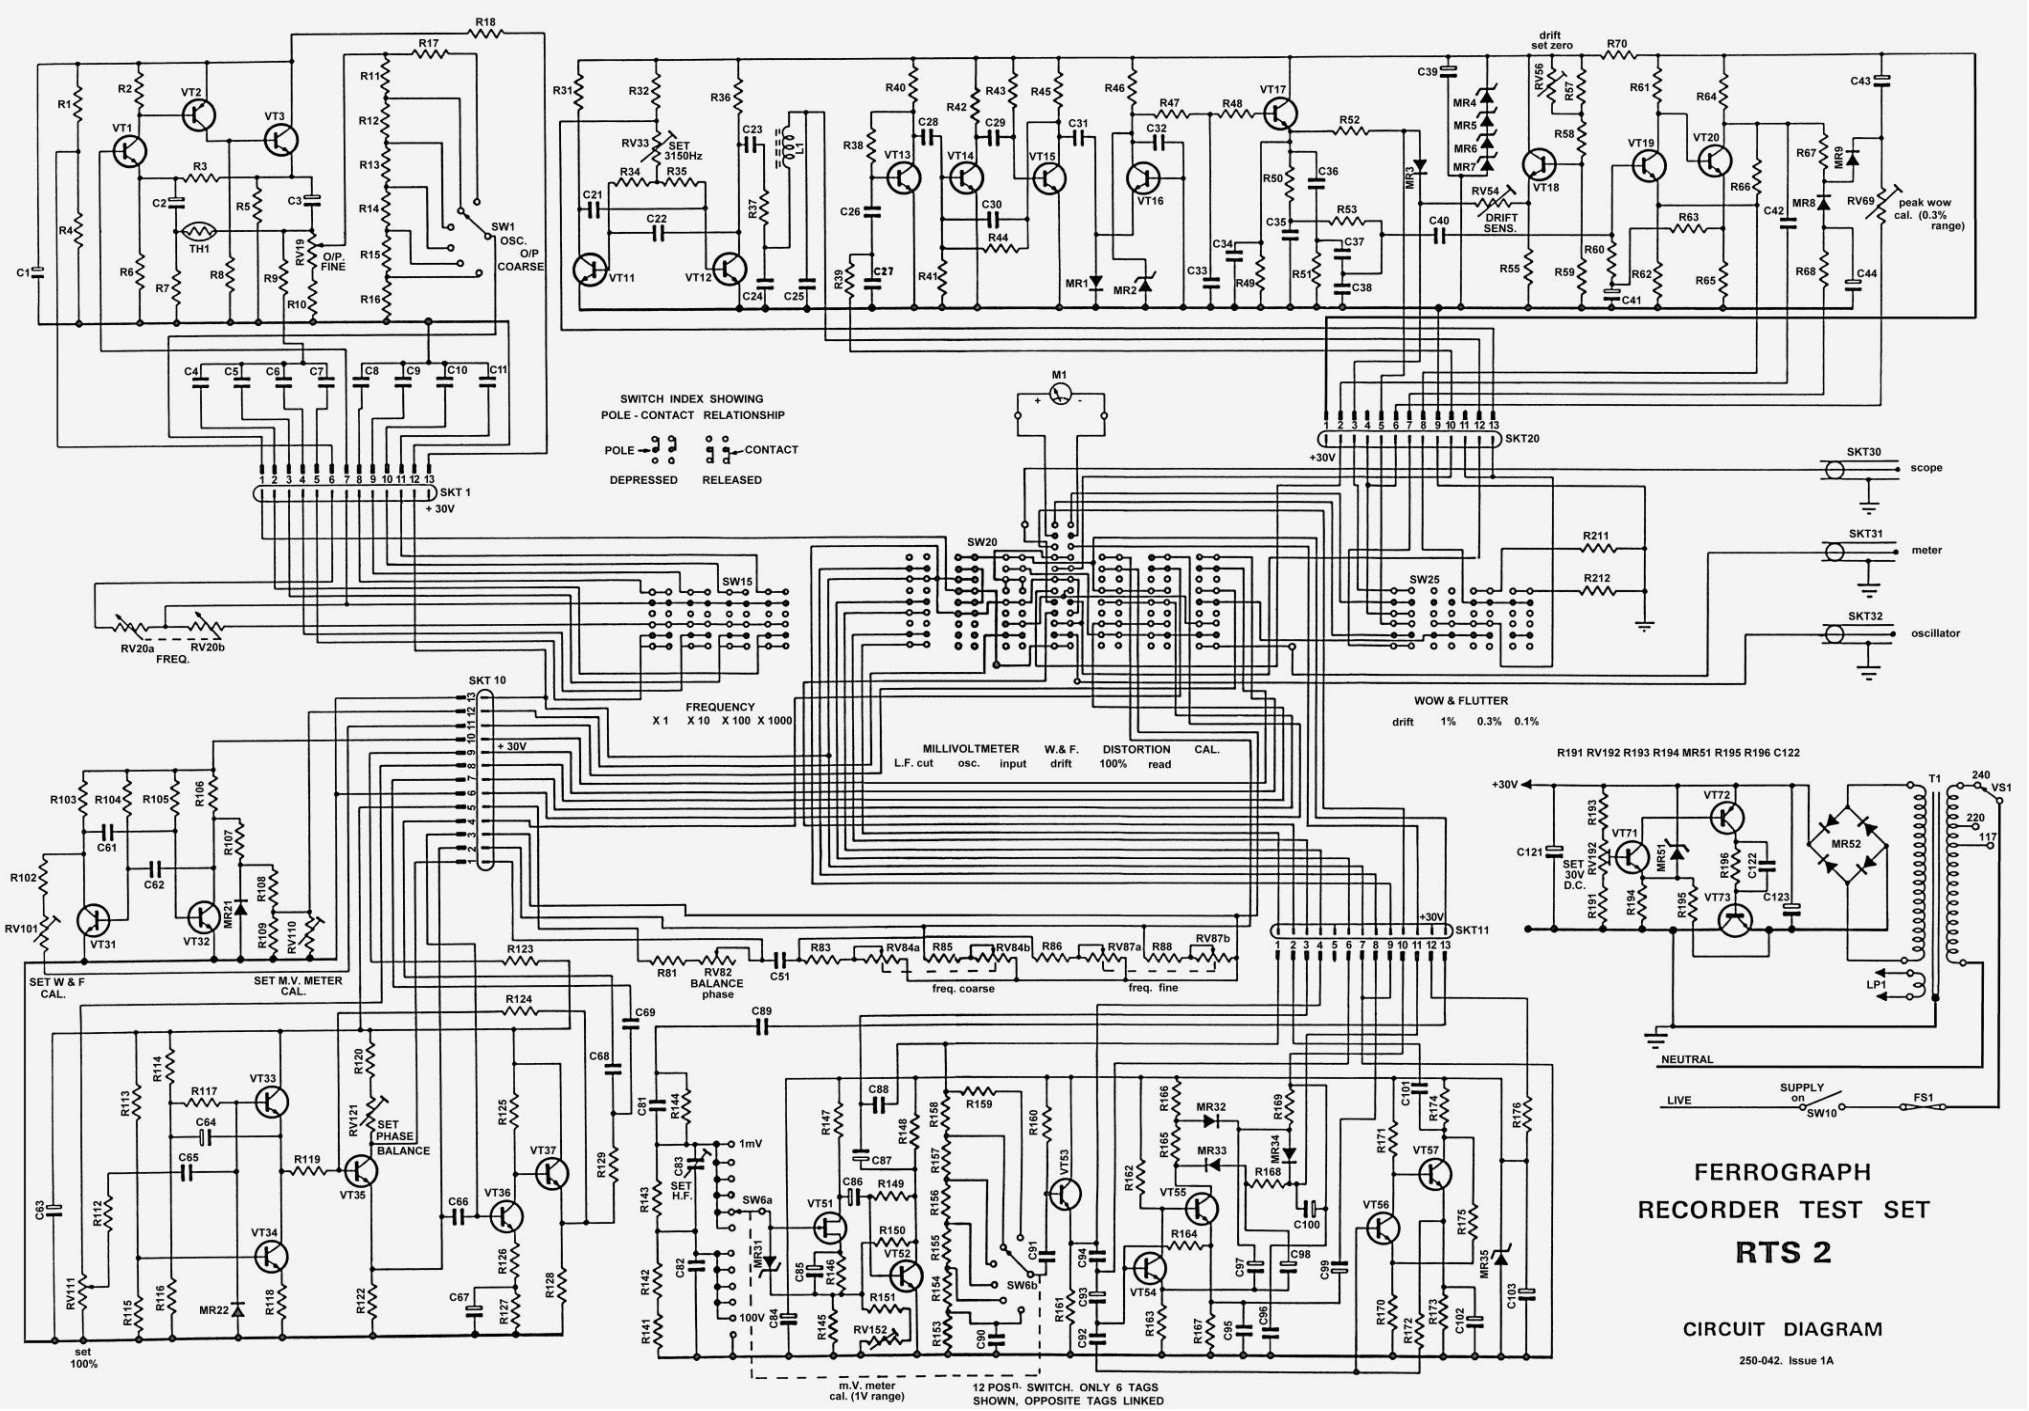
SWITCH INDEX SHOWING
POLE - CONTACT RELATIONSHIP
POLE
CONTACT
DEPRESSED
RELEASED
SKT 1
+ 30V
SKT 10
SKT11
SKT20
SKT30
scope
SKT31
meter
SKT32
oscillator
FREQUENCY
X 1 X 10 X 100 X 1000
MILLIVOLTMETER
L.F. cut osc. input drift
W.& F.
100% read
DISTORTION
CAL.
WOW & FLUTTER
drift 1% 0.3% 0.1%
drift set zero
DRIFT SENS.
peak wow cal. (0.3% range)
SET 3150Hz
O/P. FINE
O/P COARSE
SET W & F CAL.
SET M.V. METER CAL.
RV20a FREQ. RV20b
RV82 BALANCE phase
freq. coarse
freq. fine
SET PHASE BALANCE
SET H.F.
SET 30V D.C.
NEUTRAL
LIVE
SUPPLY on
SW10
FS1
LP1
m.V. meter cal. (1V range)
12 POSn. SWITCH. ONLY 6 TAGS SHOWN, OPPOSITE TAGS LINKED
FERROGRAPH
RECORDER TEST SET
RTS 2
CIRCUIT DIAGRAM
250-042. Issue 1A